

Date: Thursday, 13/11/2008 12:59:39 PM
 User: Linda Lacelle

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	LOW GEAR SKIDTUBE ASSEMBLY 206 A/B
Job Number :	43433		
Estimate Number :	11972		
P.O. Number :		Part Number :	D206642141
This Issue :	13/11/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2650 REV F
First Issue :	/ /	Project Number :	N/A
Previous Run :	41044	Drawing Revision :	F
	Type :	Material :	
	SKIDTUBES	Due Date :	28/11/2008
Written By :	Qty: 1 Um: Each		
Checked & Approved By :			
Comment :	Est Rev:H 05.10.11 ECN 847 & 901; Add Tow Ring and GHW Kit; CHG004 KJ/CP/JLM Est Rev:I 08-06-10 chg D2654-3 to -1 (seq 13) DD verified by:ec Est Rev:J 08-07-14 remove QC5 at seq.41 DD verified by:EC Est rev:K 08-09-29 revF as per dwg DD verified by:		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



for JLD 08.12.08



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-141 CHG003

2.0	D2620	Skidtube, 206 Skidtube
-----	-------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description

Batch

1 D2620

Bent Tube 3" OD

B41820

BE

10-23-8

3.0	D32861	Doubler
-----	--------	---------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description

Batch

2 D3286-1

Doubler

B41978

2

11 10-23-10 8-11-13

4.0	D2647	Cap
-----	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2647

Fwd Cap

B35475

BE 23/10/08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M 109213

BE 10-23-08

10-23-08

4-Grind weld flush to cap on top surface only.

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

JD 10-23-08

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8166 (A,B & C).

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

14
8-11-08
PD

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove and Deburr D3286-1 doubler

13-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

14-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder




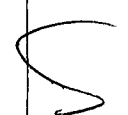
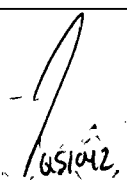



15-Remove indexing edge using DT8741 as per Dwg D2650

16-C'sink GHW rivet holes as per Dwg D2650

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D206-642-441 PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR: 43433		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
8/11/17	10	During inspection ^{but} hole is ovalized. R.C. hole was ovalized during drilling of SS. Double drill build up of chips on drill	 08/11/17	fill hole with weld as per Q57004. A/R 109213	BE 08/11/17	 08/11/17	 08/11/17	 08/11/17
			 08/11/17	Re drill and counter sink holes. K 8-11-17	11 8-11-17	 08/11/17	 08/11/17	 08/11/17

NOTE: Date & initial all entries

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

5 08/11/17 @

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes as per Dwg D2650

2-Drill pilot holes using DT8028-1, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

) H
8-11-17

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

D H 8-11-17

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DD 8-11-17

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-1 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

) H
8-11-18

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

5 08/11/18 @

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total: 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet

M1097410

(37)

H 8-11-17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26541

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

*

Web

batch:

B42445

D 11-8-11-18

14.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 8-11-17 Time: 7:50 am

Finish Date: 8/11/19 Time: 8:00 AM

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 1209449

Sikaflex expire date: 8-11-30

11-8-11-18

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8/11/19 (X)

16.0

D2649

Cross Bolt Spacer



Comment: Qty.: 17.0000 Each(s)/Unit Total: 17.0000 Each(s)

Pick:

Qty Part Number Description Batch

17 D2649 Crossbolt spacer

B42632 (XB)

BE 08/11/20

B43505 (A)

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-3 Spacer

B41900 BE 08/11/26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M109213 BE 08/11/20

2-Grind welds flush as per Dwg D2650. SL 8-11-23

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod NONE BE 8-11-26

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr JD 8-11-27

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets 109431

JD 8-11-27

20.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Cherry Rivet

batch: 106167

JD 8-11-27



21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate 34599

JD 8-11-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

22.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

Jb 8-11-27

23.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: Counterbore work to Current Step. Inspect for foreign objects as per QSI 024

24.0	QC10	VISUAL WELDING INSPECTION
------	------	---------------------------



Comment: VISUAL WELDING INSPECTION

25.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

26.0	POWDER COATING	POWDER COATING
------	----------------	----------------



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

7:40
320 °F
8:10

M-1 08/12/17

27.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION
------	-----	---



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-12-17 (X)

28.0	D26483	Wearpad
------	--------	---------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

B42770

M-1 08-12-17 (X)

W/O: 43433		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D206-642-141 PAR #: N/A Fault Category: Prod/Std Hb NCR: (Yes) No DQA: D Date: 08/12/09
 Resolution: Re-work Disposition: Re-work QA: N/C Closed: D Date: 08/12/09

NCR: <u>43433</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
08/12/01	23.0	Upon inspection (previous inspection had been done & signed) It was noticed that the most fuel saddle x-bolt is ovalized by 0.040" on one side.	/	Remove & replace the affected x-bolt spacer Qty 1 B41970 BF weld into position as per dwg.	08/12/01	S	/	/
	23.0	RC: Pulled the tool when c'boxing. Human error. 1 rivet on the tow ring nut plate is not acceptable. The stem is broke off inside the rivet head. R.C. Process (It happens)	/	Retrain Employee to ensure to position this tool 90° to the tube or in line with the c'boxed hole. Mark on the employee's Job Log.	gone	↓	/	/

NOTE: Date & initial all entries

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

D265611

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-11

Wearshoe

B35897

ju

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

B38848

ju

31.0

D265631

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-31

Wearshoe

B41736

ju

32.0

D34291

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

B42779

ju

33.0

ALS41032130

Insert



Comment: Qty.: 42.0000 Each(s)/Unit Total: 42.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

42 ALS4-1032-130 Inserts

M105819

or (see QSI 017)

ju

08-12-17

(X)

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN960JD10L

Washer



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Pick:

Qty Part Number Description Batch
42 AN960JD10L Washer M1105743

94

35.0

MS27039108

Screw



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

Pick:

Qty Part Number Description Batch
42 MS27039-1-08 Screw M1109061

94

36.0

D26511

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty Part Number Description Batch
16 D2651-1 Plugs B341991

94

37.0

D26513

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty Part Number Description Batch
16 D2651-3 O-Rings B341972

94

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 MS27039-4-06 Screw M1109061

94

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 AN960JD416 Washer M1108161

M1108161

~~M1108161~~

08.12.17 94

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

- ✓ 1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.
A/R Sikaflex-291 M1109883
Sikaflex expire date: 09/11
- ✓ 2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive.
- ✓ 3-Install MS27039-4-06 Screw as per DEO 9153.

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Pick:
Qty Part Number Description Batch
1 D2646 Aft Cap 1341435

42.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Pick:
Qty Part Number Description Batch
2 MS27039-1-08 Screw M1109061

43.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Pick:
Qty Part Number Description Batch
2 AN960JD10L Washer M1105793

Date: Thursday, 13/11/2008 12:59:40 PM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: LOW GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43433

Part Number: D206642141

Job Number:



Seq. #:

Machine Or Operation:

Description :

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

✓ A/R Sikaflex-291 M109883

Sikaflex expire date: 09/11

2-Wing Walk as per Dwg D2650-8 and QSI 005 4.4

Batch: M109917

Handwritten notes:
08-12-17
08-12-17

45.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Handwritten notes:
08/12/18

46.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP
inspect for foreing objets as per QSI 024

Handwritten notes:
08/12/18

47.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-141

Location: 91

PPP Rev: 8/12/13

Handwritten notes:
08/12/13

48.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Handwritten notes:
08/12/14

Job Completion



Handwritten notes:
08/12/13

B43433

QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
17	18	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

F



43483

RELEASED

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 11) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 12) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 13) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

F	DRAWING UPDATED TO CURRENT STANDARDS. SHT 6 ADDED. ALL SECTION AND DETAIL VIEWS TRANSFERRED TO SHT 6. SHT 1 IN PL PART D2649 QTY UPDATED. SHT 6 SECT C-C GRIND INSTRUCTIONS DELETED FROM NOTE 7 (SEE NCR 239).	AJS	08.08.08
E	RMOVE CBORE, CHG DRILL, ADD CHAMFER	CP	06.03.30
D	REDRAW: INCCRP. DE09136/9153/9163 MOD GROUND HANDLING ON D2650-1/-3	CP	04.05.17
C	CHANGE HOLE PATTERN AND FRONT END	DS	97.10.29
B	AS MANUFACTURED CHANGES	DS	97.06.26
A	NEW ISSUE	DS	97.03.25
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED	J	DRAWING NO.	REV. F
MFG. APPR.	E	D2650	SHEET 1 OF 6
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

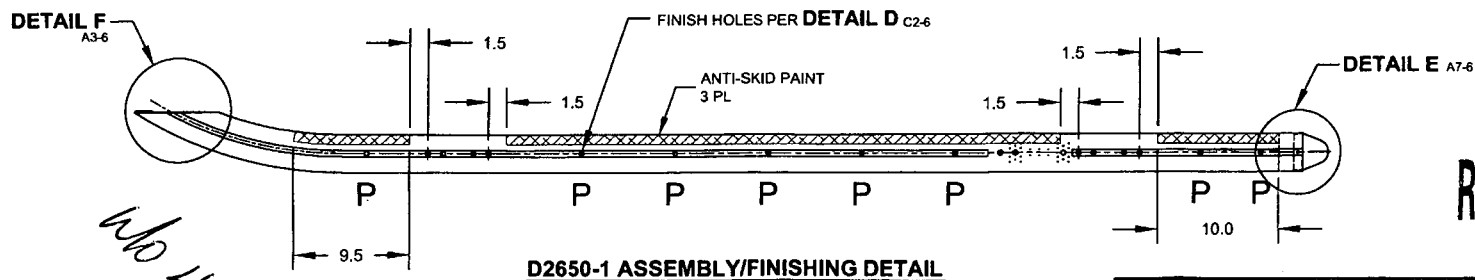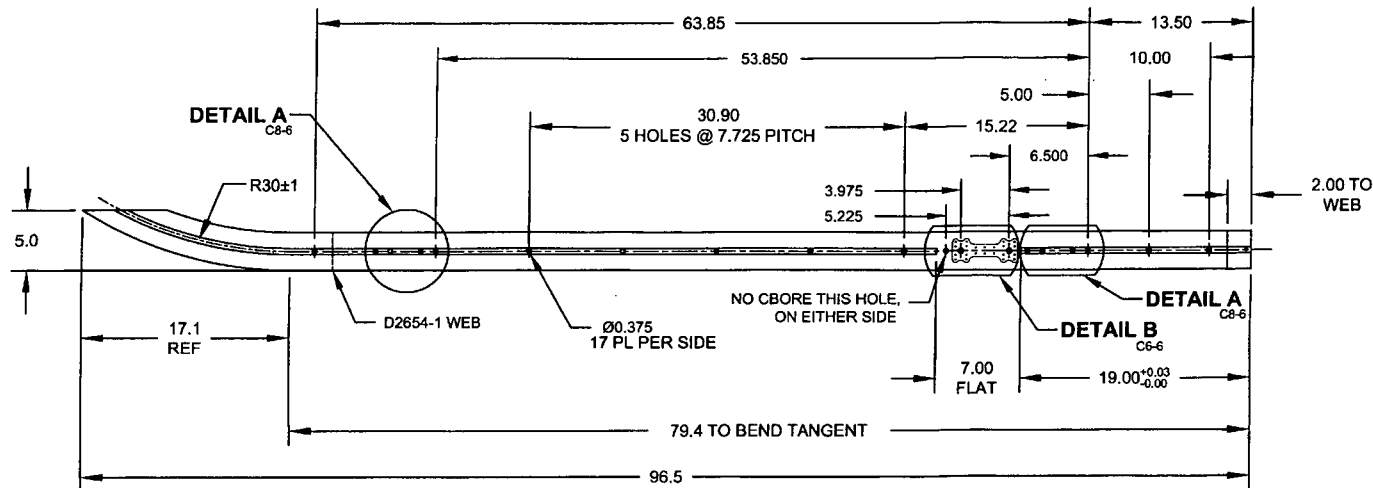


RELEASED
680922/118

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 2 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

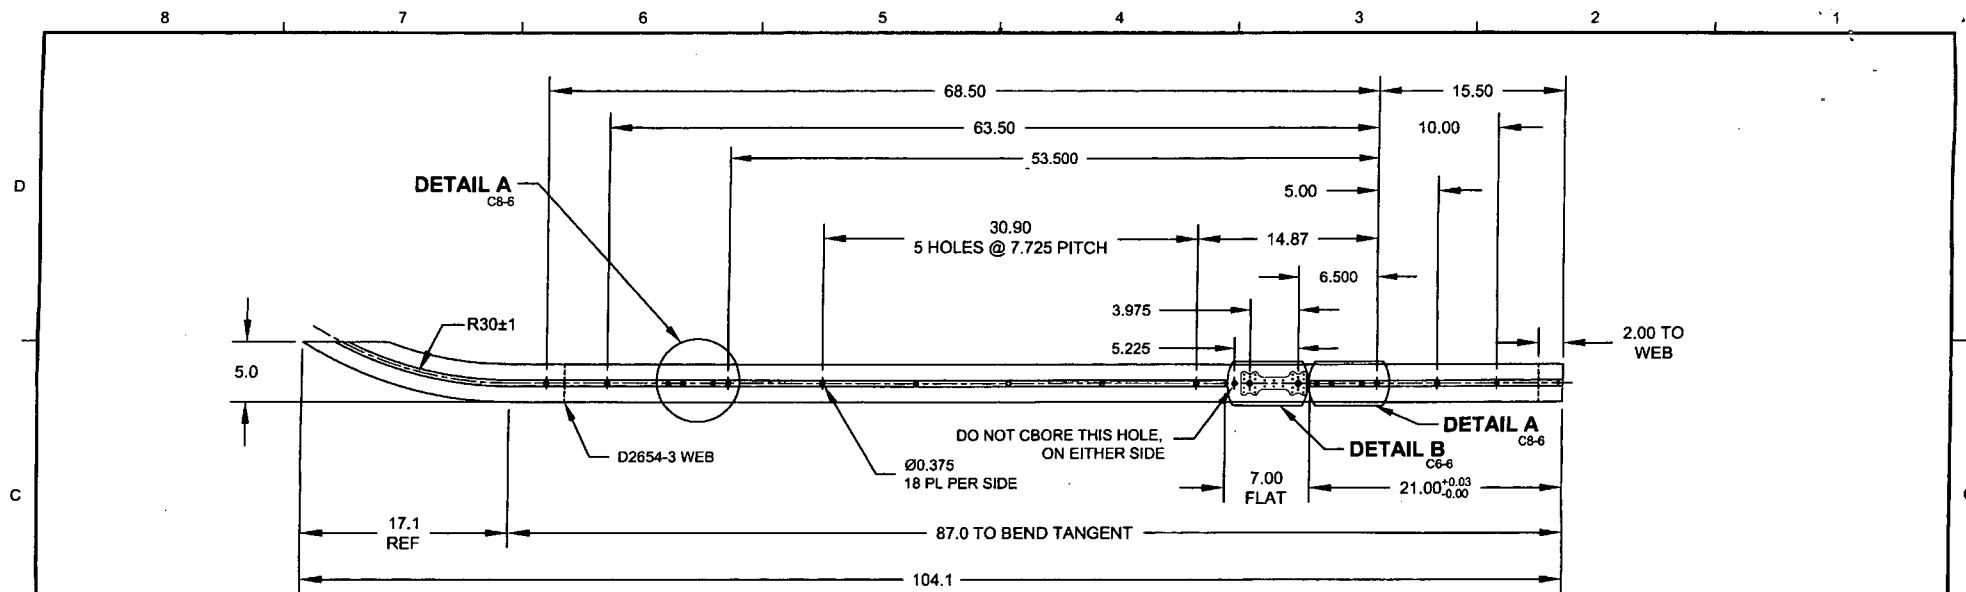

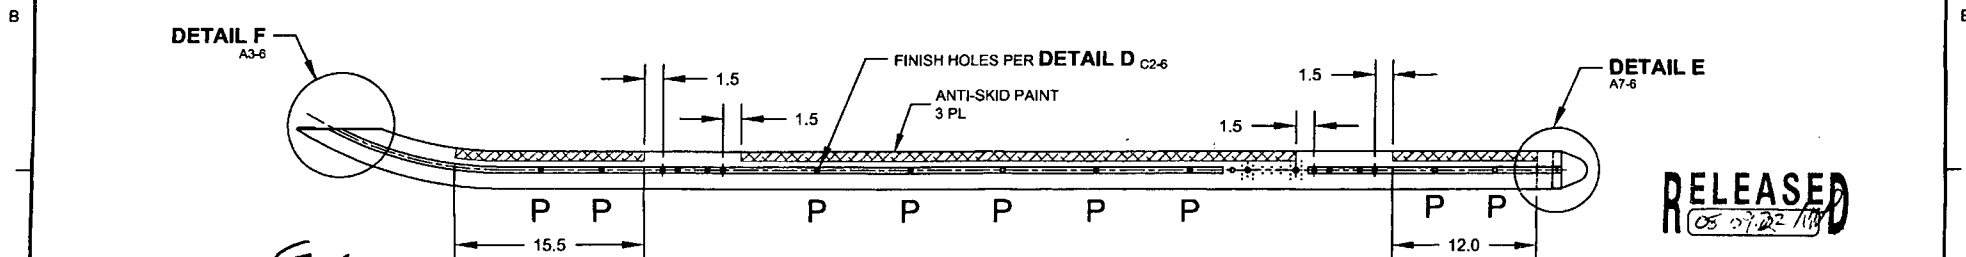


D2650-3 BENDING/DRILLING DETAIL





D2650-3 ASSEMBLY/FINISHING DETAIL

Wb 43433

RELEASED
05 07 22 1988


DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 3 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

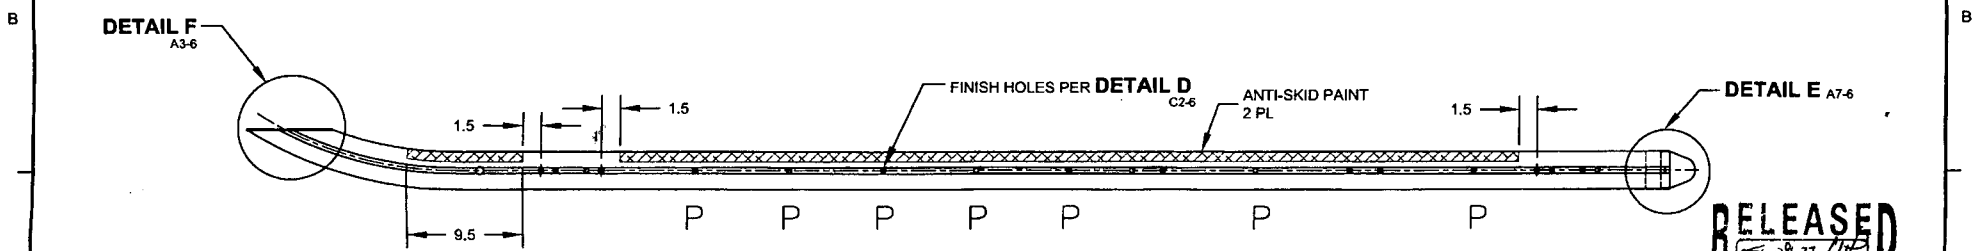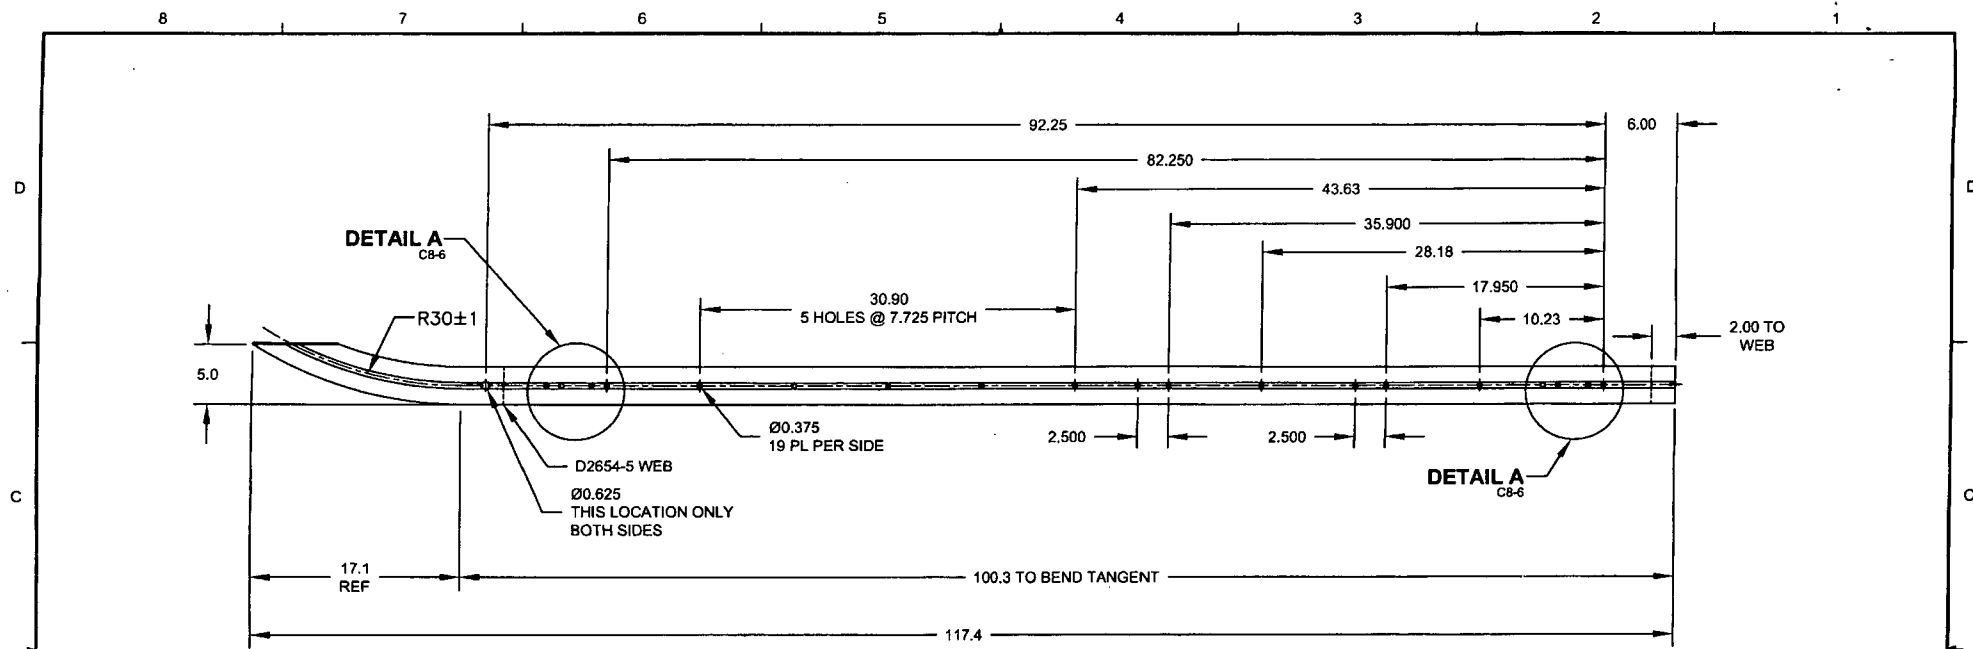


W643433

RELEASED
08-09-22/11/17

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED	J	DRAWING NO. D2650	REV. F
MFG. APPR.	J	SHEET 4 OF 6	
APPROVED	J	TITLE	SCALE
DE APPR.	J	206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

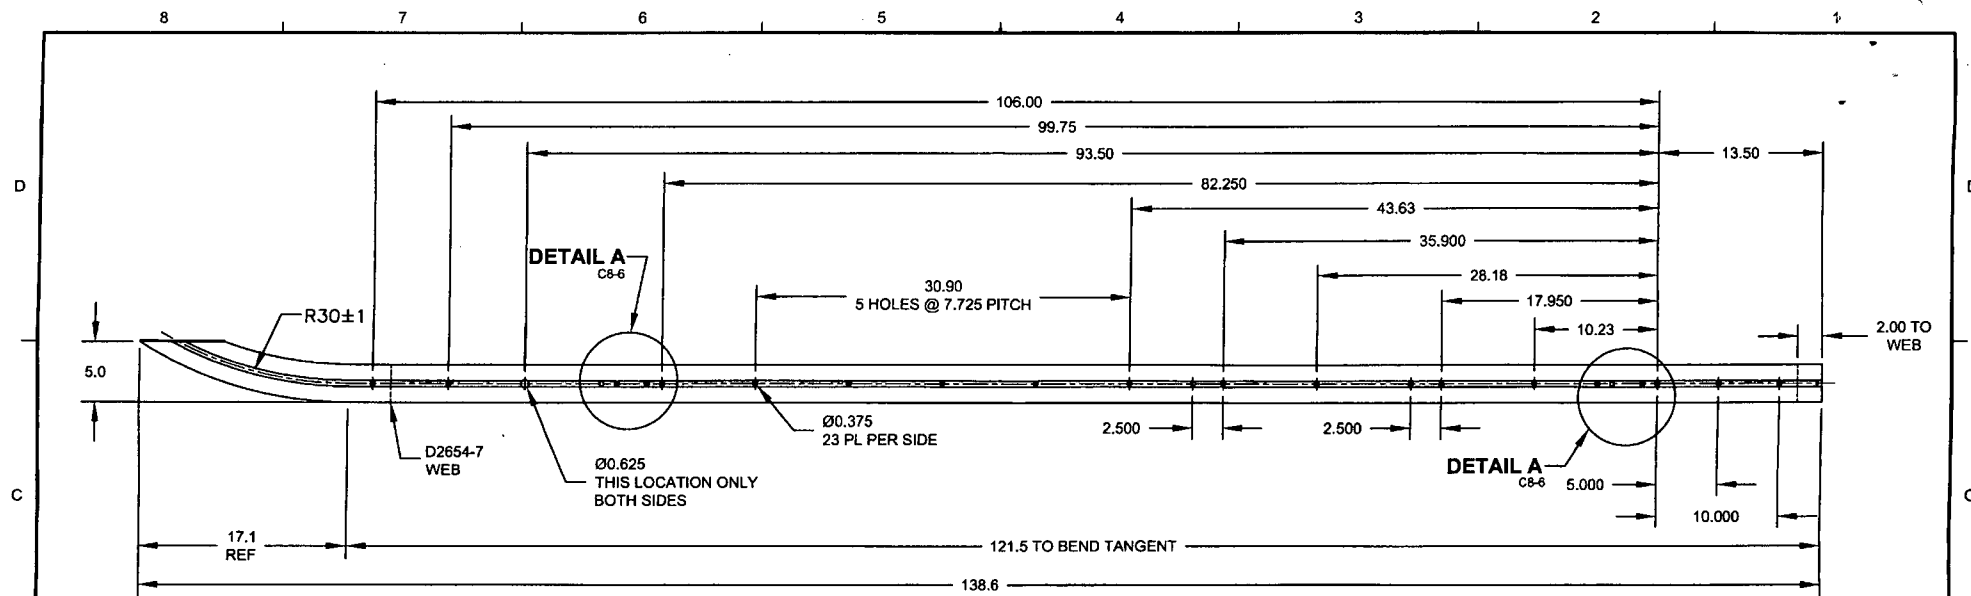

D2650-7 BENDING/DRILL DETAIL

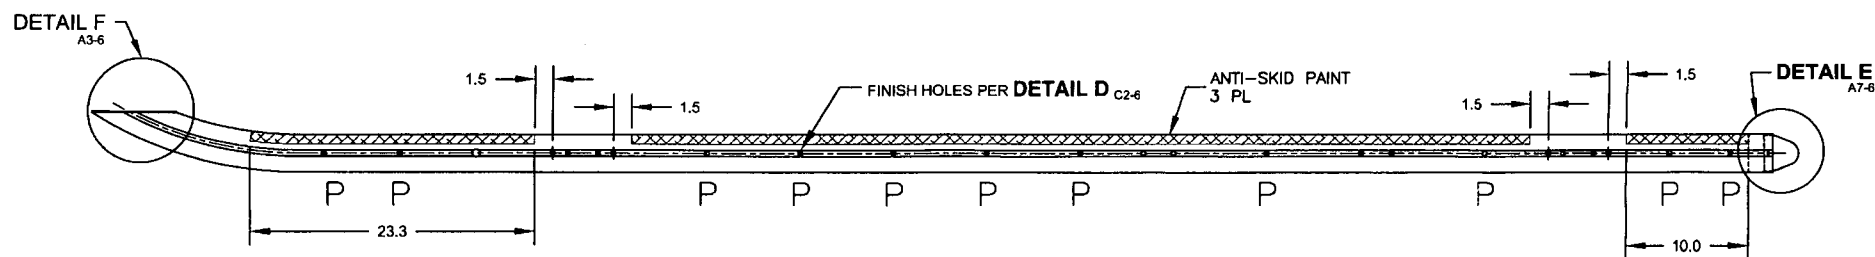


D2650-7 ASSEMBLY/FINISHING DETAIL

RELEASED
06 07-22-74


DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED	J	DRAWING NO.	REV. F
MFG. APPR.	E	D2650	SHEET 5 OF 6
APPROVED	H	TITLE	SCALE
DE APPR.	H	206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

206/407 33

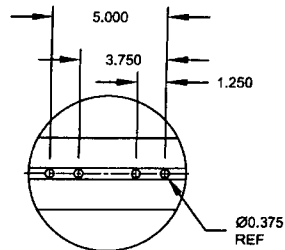

DETAIL A
SCALE 2X

C2-2
D7-2
C2-3
D7-3
C2-4
D7-4
C2-5
D6-5

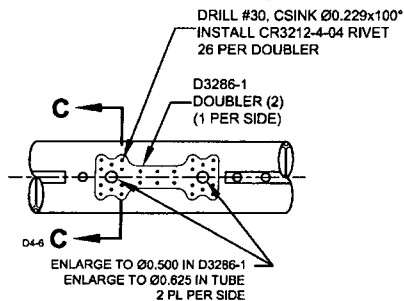



DETAIL B
SCALE 2X

C3-2
C3-3

- TO INSTALL D3286-1/3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO Ø0.500
 4. ENLARGE HOLES IN TUBE TO Ø0.625 AND CHAMFER HOLE 0.030x45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE.




SECTION C-C C7-6
SCALE NONE

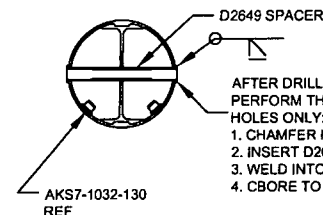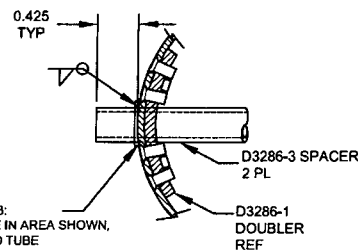


DETAIL D
FOR Ø0.375 HOLES ONLY
SCALE 3X

B4-2
B4-3
B4-4
B4-5

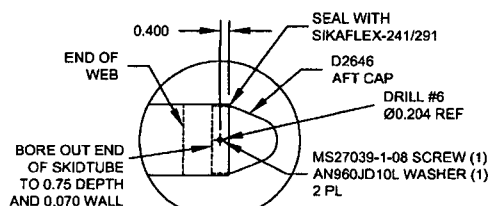

DETAIL E
SCALE 2X

 B2-2
B2-3
B1-4
B1-5



DETAIL F
SCALE NONE

B8-2
B8-3
B8-4
B8-5

DETAIL F NOTES:

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

RELEASED

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 6 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO. 184

**AWS D17.1.2001
QUALIFICATION TEST RECORD**

Name: Barclay Elliot
Job number: B43107A
Part number: 1206 642 241
Description: 206 Skid tube
Welding Process: Tig[☒] Mig[]
Base material: Alum
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier David Paul Date of Test Coupon 08/11/28
Welder Barclay Elliot Date of Test Coupon 08/11/28

The above named individual is qualified in accordance with AWS D17.1.2001 to weld